



Item: 5	Comply with FAR91.207d. (ELT)				
Corrective Action:	ELT inspected and operational checked I/A/W FAR91.207d. Battery due time change 11/12.				
	Labor Charges -	0.65 @	\$76.00	+\$0.00=	\$49.40
				Labor SubTotal	\$49.40
				Item SubTotal	\$49.40
Item: 6	Compression check				
Corrective Action:	31 80/70 #2 80/72 #3 80/72 #4 80/74 #5 80/70 #6 80/72.				
	Labor Charges -	0.00 @	\$76.00	+\$0.00=	\$0.00
				Item SubTotal	\$0.00
Item: 7	Comply with a oil and filter change. Inspect filter for contamination.				
Corrective Action:	Oil and filter change complied with. No contamination found in filter. 7 qts Aeroshell 15/50 and a new CH48108-1 filter installed. Leak checked OK.				
	Labor Charges -	0.00 @	\$76.00	+\$0.00=	\$0.00
				Item SubTotal	\$0.00
Item: 8	LH wing forward inboard panel missing screws.				
Corrective Action:	Installed missing screws in LH wing.				
	Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20
				Labor SubTotal	\$15.20
				Item SubTotal	\$15.20
Item: 9	Cabin heat duct not attached to heater control valve.				
Corrective Action:	Reattached heater duct to heater control valve.				
	Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20
				Labor SubTotal	\$15.20
				Item SubTotal	\$15.20
Item: 10	Panel light control knob loose.				
Corrective Action:	Retorqued panel light control knob set screw.				
	Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20
				Labor SubTotal	\$15.20
				Item SubTotal	\$15.20

Item: 11	Pilots shoulder harness attach bolt loose.					
Corrective Action:	Pilots shoulder harness attach bolt torqued.					
	Labor Charges -	0.15 @	\$76.00	+\$0.00=	\$11.40	
						Labor SubTotal \$11.40
						Item SubTotal \$11.40
Item: 12	Both L&R elevator patches cracked.					
Corrective Action:	Repaired both L&R elevator cracked patches.					
	Labor Charges -	4.80 @	\$76.00	+\$0.00=	\$364.80	
						Labor SubTotal \$364.80
						Item SubTotal \$364.80
Item: 13	Two rocker box covers seeping oil.					
Corrective Action:	Retorqued all rocker box cover screws.					
	Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20	
						Labor SubTotal \$15.20
						Item SubTotal \$15.20
Item: 14	RH cabin door very stiff to open from inside.					
Corrective Action:	Lubed mechanism. Checks OK.					
	Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20	
						Labor SubTotal \$15.20
						Item SubTotal \$15.20
Item: 15	Map case door missing cover.					
Corrective Action:	Made cover for map case and installed.					
	Labor Charges -	1.60 @	\$76.00	+\$0.00=	\$121.60	
						Labor SubTotal \$121.60
						Item SubTotal \$121.60
Item: 16	Lower radio stack missing cover.					
Corrective Action:	Made cover for lower radio stack and installed.					
	Labor Charges -	1.20 @	\$76.00	+\$0.00=	\$91.20	

Labor SubTotal	\$91.20
Item SubTotal	\$91.20

Item: 17      Landing light inoperative.  
 Corrective    Removed and replaced landing light lamp.  
 Action:

Labor Charges -	0.40 @	\$76.00	+\$0.00=	\$30.40
-----------------	--------	---------	----------	---------

Labor SubTotal	\$30.40
Item SubTotal	\$30.40

Item: 18      RH lower cowl mount broken.  
 Corrective    Removed and replaced lower RH cowl mount.  
 Action:

Labor Charges -	0.35 @	\$76.00	+\$0.00=	\$26.60
-----------------	--------	---------	----------	---------

Labor SubTotal	\$26.60
Item SubTotal	\$26.60

Item: 19      Pitot mast loose in mount.  
 Corrective    Tapped pitot mast and installed #6 mount screws.  
 Action:

Labor Charges -	0.75 @	\$76.00	+\$0.00=	\$57.00
-----------------	--------	---------	----------	---------

Labor SubTotal	\$57.00
Item SubTotal	\$57.00

Item: 20      Fuel selector plastic cover in poor condition.  
 Corrective    Taped weak areas of fuel selector cover.  
 Action:

Labor Charges -	0.20 @	\$76.00	+\$0.00=	\$15.20
-----------------	--------	---------	----------	---------

Labor SubTotal	\$15.20
Item SubTotal	\$15.20

Item: 21      Comply with annual spark plug service.  
 Corrective    All spark plugs were cleaned, regapped, tested, and rotated when reinstalled.  
 Action:

Labor Charges -	0.90 @	\$76.00	+\$0.00=	\$68.40
-----------------	--------	---------	----------	---------

Labor SubTotal	\$68.40
Item SubTotal	\$68.40

Item: 22      Comply with annual battery service.  
 Corrective    Battery, battery box and connections cleaned. battery was serviced, recharged, and tested OK.  
 Action:

Labor Charges -	0.65 @	\$76.00	+\$0.00=	\$49.40
			Labor SubTotal	\$49.40
			Item SubTotal	\$49.40

Item: 23 Comply with annual propeller service.  
 Corrective Action: Propeller was cleaned, leading edges dressed, and face repainted.

Labor Charges -	0.60 @	\$76.00	+\$0.00=	\$45.60
			Labor SubTotal	\$45.60
			Item SubTotal	\$45.60

Item: 24 Engine induction filter is due time change.  
 Corrective Action: Engine induction filter removed and replaced.

Labor Charges -	0.45 @	\$76.00	+\$0.00=	\$34.20
			Labor SubTotal	\$34.20
			Item SubTotal	\$34.20

Item: 25 Comply with annual airframe, engine, flight controls, and landing gear lubrication.  
 Corrective Action: Annual airframe, engine, flight control, and landing gear lubrication complied with.

Labor Charges -	2.40 @	\$76.00	+\$0.00=	\$182.40
			Labor SubTotal	\$182.40
			Item SubTotal	\$182.40

Part #	Description	Quantity	Price	Tax	Total
BA111	Induction Filter	1	\$95.42	\$0.00	\$95.42
CH48108-1	OIL FILTER	1	\$24.27	\$0.00	\$24.27
15W/50	AEROSHELL OIL	7	\$8.50	\$0.00	\$59.50
J7444-14	Mount Cowl	1	\$22.96	\$0.00	\$22.96
GE4591	Lamp	1	\$26.70	\$0.00	\$26.70
AN900-10	Gasket	1	\$1.26	\$0.00	\$1.26
Misc.	Hardware	1	\$24.70	\$0.00	\$24.70

Outside Labor	\$0.00
Outside Parts	\$0.00
Total Parts	\$254.81
Labor Hours	32.5
Total Labor	\$2,470.00
Tax	\$0.00
Total	\$2,724.81